


MAZAK TURRET

Angular drilling and milling head

Direction of rotation: ↻

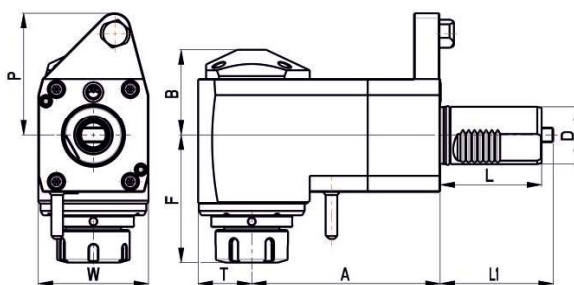


TERMINATION CODE: MZ1

QT 100 M/MS/MY/MSY (STAR)
QT 200 M/MS/MY/MSY 16ST (STAR)
QT 250 M/MS/MY/MSY 16ST (STAR)
QTN 100 M/MS/MY/MSY (STAR)
QTNX 100 M/MS/MY/MSY (STAR)
QTNX 200 M/MS/MY/MSY 16ST (STAR)
QTNX 250 M/MS/MY/MSY 16ST (STAR)
SQT 10 M/MS (STAR)
SQT 100 M/MS/MY/MSY (STAR)
SQT 200 M/MS/MY/MSY (STAR)
SQT 200 M/MS/MY/MSY 16ST (STAR)
SQT 250 M/MS/MY/MSY (STAR)
SQT 250 M/MS/MY/MSY 16ST (STAR)

Code	D	Tool grip	IC	Direction	A	B	F	L	L1	P	T	W	Torque [Nm]	Speed [rpm]	Ratio	P [bar]
NGT1-40/221-32/1.1-100MZ1	40	ER32	no	right	100	59	88	60	61	79	37	76	50	6000	1:1	-
NGT1-40/221-32/2.1-100MZ1	40	ER32	yes	right	100	62	88	60	61	79	37	76	50	6000	1:1	20
NGT1-40/221-32/3.1-100MZ1	40	ER32	yes	right	100	72	88	60	61	79	37	76	50	6000	1:1	80
NGT1-40/221-32/1.2-100MZ1	40	ER32	no	left	100	59	88	60	61	79	37	76	50	6000	1:1	-
NGT1-40/221-32/2.2-100MZ1	40	ER32	yes	left	100	62	88	60	61	79	37	76	50	6000	1:1	20
NGT1-40/221-32/3.2-100MZ1	40	ER32	yes	left	100	72	88	60	61	79	37	76	50	6000	1:1	80
NGT1-40/221-32/1.1-130MZ2	40	ER32	no	right	130	59	88	70	78	84	37	76	50	6000	1:1	-
NGT1-40/221-32/2.1-130MZ2	40	ER32	yes	right	130	62	88	70	78	84	37	76	50	6000	1:1	20
NGT1-40/221-32/3.1-130MZ2	40	ER32	yes	right	130	72	88	70	78	84	37	76	50	6000	1:1	80
NGT1-40/221-32/1.2-130MZ2	40	ER32	no	left	130	59	88	70	78	84	37	76	50	6000	1:1	-
NGT1-40/221-32/2.2-130MZ2	40	ER32	yes	left	130	62	88	70	78	84	37	76	50	6000	1:1	20
NGT1-40/221-32/3.2-130MZ2	40	ER32	yes	left	130	72	88	70	78	84	37	76	50	6000	1:1	80

Offset straight drilling and milling head

Direction of rotation: ↻

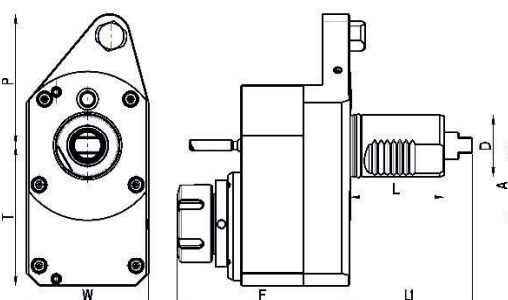

TERMINATION CODE: MZ2

IVS - 200, 300 M (STAR)
MZ40V (STAR)
QT 200 M/MS/MY/MSY (STAR)
QT 250 M/MS/MY/MSY (STAR)
QTN 200 M/MS/MY/MSY (STAR)
QTN 250 M/MS/MY/MSY (STAR)
SQT 15 M/MS/MY/MSY (STAR)
SQT 18 M/MS/MY/MSY (STAR)
SQT 200 M/MS/MY/MSY (STAR)
SQT 250 M/MS/MY/MSY (STAR)
Super Quadrex 200 m (STAR)
Super Quadrex 250 m (STAR)

Code	D	Tool grip	IC	Direction	A	F	L	L1	P	T	W	Torque [Nm]	Speed [rpm]	Ratio	P [bar]
NGT1-40/321-32/1.1-50MZ1	40	ER32	no	right	50	111	60	61	84	90	78	50	6000	1:1	-
NGT1-40/321-32/2.1-50MZ1	40	ER32	yes	right	50	111	60	61	84	90	78	50	6000	1:1	20
NGT1-40/321-32/1.1-50MZ1(1:2)	40	ER32	no	right	50	111	60	61	84	90	78	25	12000	1:2	-
NGT1-40/321-32/2.1-50MZ1(1:2)	40	ER32	yes	right	50	111	60	61	84	90	78	25	12000	1:2	-
NGT1-40/321-32/1.1-50MZ1(2:1)	40	ER32	no	right	50	111	60	61	84	90	78	80	3000	2:1	20
NGT1-40/321-32/2.1-50MZ1(2:1)	40	ER32	yes	right	50	111	60	61	84	90	78	80	3000	2:1	-
NGT1-40/321-32/1.1-50MZ2	40	ER32	no	right	50	111	60	78	84	90	78	50	6000	1:1	20
NGT1-40/321-32/2.1-50MZ2	40	ER32	yes	right	50	111	60	78	84	90	78	50	6000	1:1	-
NGT1-40/321-32/1.1-50MZ2(1:2)	40	ER32	no	right	50	111	60	78	84	90	78	25	12000	1:2	20
NGT1-40/321-32/2.1-50MZ2(1:2)	40	ER32	yes	right	50	111	60	78	84	90	78	25	12000	1:2	-
NGT1-40/321-32/1.1-50MZ2(2:1)	40	ER32	no	right	50	111	60	78	84	90	78	80	3000	2:1	20
NGT1-40/321-32/2.1-50MZ2(2:1)	40	ER32	yes	right	50	111	60	78	84	90	7	80	3000	2:1	-